



HYUNDAI Technical Service Bulletin

Group	TRANSAXLE
Number	04-40-013
Date	SEPTEMBER, 2004
Model	SANTA FE 2.4L

Subject

INCREASED CLUTCH DURABILITY

CIRCULATE TO:	<input type="checkbox"/> GENERAL MANAGER	<input checked="" type="checkbox"/> PARTS MANAGER	<input checked="" type="checkbox"/> TECHNICIAN
<input checked="" type="checkbox"/> SERVICE ADVISOR	<input checked="" type="checkbox"/> SERVICE MANAGER	<input checked="" type="checkbox"/> WARRANTY MGR	<input type="checkbox"/> SALES MANAGER


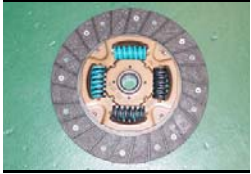
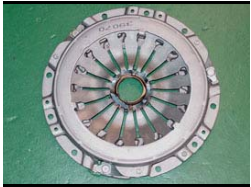


DESCRIPTION:

To increase the durability of the clutch in 2.4L manual transaxle Santa Fe vehicles, the Dual Mass Flywheel and its components may be replaced with the Single Mass Flywheel (SMF) system in accordance with the applicable Shop Manuals' replacement procedures.

AFFECTED VEHICLES:

All Santa FE (SM) 2.4L vehicles with manual transaxles produced through July 16, 2003.

PARTS INFORMATION:

PART NAME	PART NUMBER		QTY	REMARKS
	PREVIOUS (DMF)	NEW (SMF)		
Flywheel assembly	23260-38220	 23210-38011	1	
Disc assembly-clutch	41100-3A140	 41100-3A150	1	
Cover assembly-clutch	41300-39115	 41300-39150	1	
Bolt	11703-08161	 11233-08201	6	For assembly between cover and flywheel
Bolt-flywheel	23286-38200	 23311-23000	7	For assembly between crank shaft and flywheel
Pin-dowel	14303-08240	14303-08240	3	



HYUNDAI Technical Service Bulletin

Group	TRANSAXLE
Number	04-40-013

WARRANTY INFORMATION:

OP CODE	OPERATION	OP TIME	CODE	
			NATURE	CAUSE
23200R0F	Clutch disc, clutch cover and flywheel replacement (2WD)	5.8 M/H	*N29	**C11

*N29: Abnormal noise

** C11: Abnormal wear